


WERK SMARTER

...not harder!

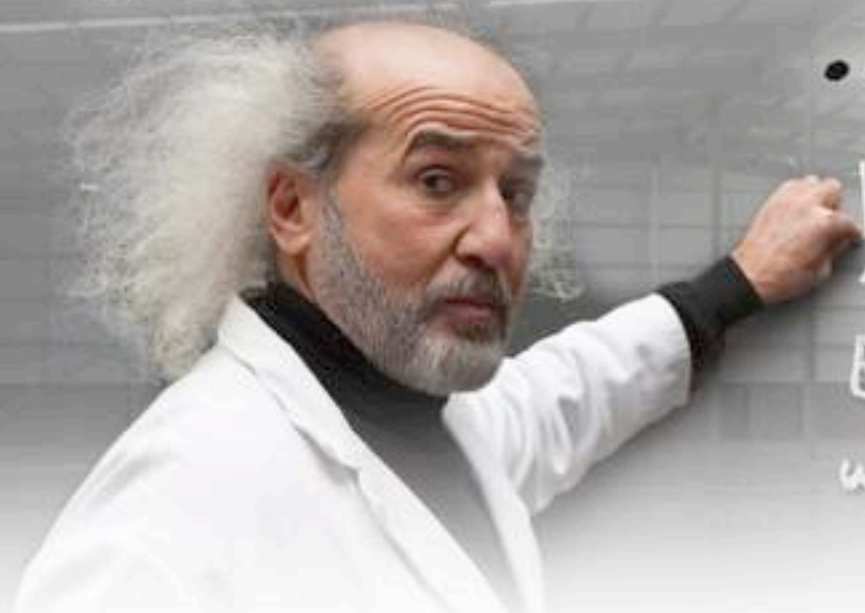

1/8"
to the
wall!

**You do the Math
1 WerkMaster =
Prep 2 Polish
+ Edging**

7 Machines in 1

- Grinder
- Edger
- Sander
- Polisher
- Stripper
- Buffer
- Burnisher

Add up the cost of today's planetary system:

(1 - Grinder) + (1 - Edger) + (1 - Burnisher) = 3 Machines + (Additional Labor) + (More Time) + (Sore Knees) + (Extra Mobilization) = **y?**

No Matter how you do the math - WerkMaster adds up to being the #1 Solution for today's surface prep and polishing contractor



Enhancement Products



Scarb
by WERKMASTER



Termite



VIPER



raptor



TITAN XT



COLOSSOS XT



TITAN
Propane



COLOSSOS
Propane
XT



SPECTRAE



STEALTH

MACHINE SPECIFICATIONS

	Scarab	Termite XT	Viper XT	Raptor XT	Titan XT	Titan XT	Colossos XT	Colossos XT
		110V	230V	230V	230V / 460V	Propane	230V / 460V	Propane
Footprint: IN (cm)	7x10 (18 x25)	14 (30.5)	17 (43.2)	17 (43.2)	20 (50.8)	20 (50.8)	24 (61)	24 (61)
Disc Size: IN (cm)	3 (7.6)	3 (7.6)	5 (12.7)	5 (12.7)	6 3/4 (17.1)	6 3/4 (17.1)	8 (20.3)	8 (20.3)
Weight: LBS (Kg)	20 (9) w/o drive unit	110 (50)	205 (93)	260 (118)	580 (263)	565 (256)	820 (372)	765 (347)
Disc Speed Range: RPM	0-2800	425-1800	425-1800	450-2100	450-1950	300-900	450-1950	300-900
Horsepower	as per drive unit	1	3	5	10	21	20	31
Voltage: VAC	as per drive unit	110	208/230 (110+)	208/230 (110+)	208/230 380/460	12VDC	208/230/380/460	12VDC
Frequency: Hz	as per drive unit	50/60	50/60	50/60	50/60	N/A	50/60	N/A
Electric Phase: Ph		1	1	1,3 Dual	1,3 Dual 3	N/A	3	N/A
Breaker Size: Amp	N/A	15	20	30	50 30	N/A	50 30	N/A
Vacuum Req: CFM	150	150	150	200	300+	300+	500+	500+
Min. Generator: kW*	2.0+	2.5+	4.0+	6.0+	11.5+	N/A	25.5+	N/A
Max Cable Length: Ft (m)**	50+ (15+)	50+ (15+)	350+ (107+)	350+ (107+)	350+ (107+)	N/A	350+ (107+)	N/A

* Current reading measured at the machine.

*** Maximum usable cable length depends on cable quality and cable gauge.

+ Using Quick 220 Adapter

** Minimum generator recommendations are based on the continuous kW rating of the generator not the peak/maximum kW rating. Never use a generator that doesn't meet the minimum requirement as damage might occur.

FLOOR PREPARATION & POLISHING

	Termite XT	Viper XT	Raptor XT	Titan XT	Colossos XT
Glue sq ft/hr (m ² /hr)	25-75 (2-7)	75-150 (7-14)	150-300 (14-28)	450-650 (42-60)	650-900 (42-84)
Paint sq ft/hr (m ² /hr)	50-100 (4-9)	100-200 (9-18)	300-450 (27-42)	550-900 (51-84)	900-1200 (84-111)
Epoxy sq ft/hr (m ² /hr)	25-100 (2-9)	75-200 (7-18)	250-400 (23-37)	500-800 (46-74)	800-1100 (74-102)
Thinset sq ft/hr (m ² /hr)	50-150 (4-14)	100-300 (9-27)	300-450 (27-42)	550-900 (51-84)	900-1800 (84-167)
Concrete sq ft/hr (m ² /hr)	75-300 (7-27)	300-450 (27-42)	500-800 (46-74)	700-1000 (65-93)	1000-2500 (93-232)
Grind & Polish sq ft/DAY (m ² /DAY)	300-500(27-46)	500-800 (46-74)	800-1200 (74-111)	1500-2500 (139-232)	1500-3500 (139-325)

* Please note all statistics include edging. Production numbers may vary according to surface conditions, diamonds used, operator, etc.

DIAMOND LIFE

	PLUG 'N GO PCD's	PLUG 'N GO SUPER BRAZED	PLUG 'N GO METAL BOND SEGMENTS	PLUG 'N GO RESINS
Diamond Life* sq ft/hr (m ² /hr)	25 000 - 75 000 (2323 - 6968 +)	10 000 - 15 000 (929 - 1394)	10 000 - 30 000 (929 - 2787)	5 000 - 30 000 (465 - 2787)

* Production numbers may vary according to surface conditions, diamonds used, operator, etc.



Save Time, Money and Diamond Life

Always test the hardness of concrete before proceeding.

Ask about our MOHS Hardness Test Kit

Watch the video at:

www.werkmaster.com/mohs-concrete-tester



QUICK 220 Voltage Adapter

Allows you to easily power 220V equipment from ordinary household 115V or 120V outlets. To use the converter, plug it into two individual household outlets on separate breakers, connect 220V equipment and begin to use.